

Work Order ID 94460

December-19-12 11:14:44 AM

94460

Page 1

Item ID: D412-742-043 Accept

Revision ID:

Item Name: Replacement Float Skidtube

Start Date: 1/21/13 Start Qty: 1.00 *1*

Required Date: 1/21/13 Req'd Qty: 1.00 *1*

Reference:

N900040100

Setup Start *NS1*

Stop *NS2*

Cust Item ID:

Customer:

Approvals: Process Plan: MJS Date: 12-12-19 Tooling:

QC: _____ Date: _____ SPC (Y/N): _____

Run Start *NR1*

Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr	Revision Nbr
----------	--------------

D3391	1
-------	---

100	DOCUMENT CONTROL	0.00
-----	------------------	------

100		
DC	Memo	0.00

Document Control If D412-742-043 is a W/O on it's own,
Photocopy bluefile and create labels per PPP D412-742-043 CHG005

[Handwritten signature]

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. <u>6</u> NCR No. _____				DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		AGAINST DEPARTMENT/PROCESS <div style="display: flex; justify-content: space-between;"> <div> Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab <input type="checkbox"/> </div> <div> Crosstube <input type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite <input type="checkbox"/> </div> <div> Water Jet <input type="checkbox"/> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier <input type="checkbox"/> </div> <div> Engineering <input type="checkbox"/> Quality <input type="checkbox"/> Other <input type="checkbox"/> </div> </div>					
Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector		
Doc/Data											
Equip/Tooling											
Operator											
Material											
Setup											
Other											
Process											
Supplier											
Training											
Unapproved											

FAULT CATEGORY				
Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions	<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other	

Work Order ID 94460

94460

Page 2

December-19-12 11:14:44 AM

Item ID: D412-742-043 Accept
 Revision ID:
 Item Name: Replacement Float Skidtube
 Start Date: 1/21/13 Start Qty: 1.00 *1*
 Required Date: 1/21/13 Req'd Qty: 1.00 *1*
 Reference:

N900040100 Setup Start *NS1*
 Stop *NS2*
 Cust Item ID:
 Customer:

Approvals: Process Plan: _____ Date: _____ Tooling: _____
 QC: _____ Date: _____ SPC (Y/N): _____

Run Start *NR1*
 Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
110	HandFinishing	0.00							
110	HandFinish	0.00							
Hand Finishing	<div>Memo</div> <div>1-Install tubes together and seal them all the way around using Sikaflex 241/291. Ensure tube ends line-up with saddle holes for proper alignment. using 7/16" "T" Pins. A/RSikaflex-241/-291 <u>M1124958</u> Expiry date: <u>13/03</u></div> <div>2-Install wearplates as per Dwg D3391. Ensure that plastic washers are against wearplate, then topped with the SS washer. Seal all bolts with sikaflex except ones with inserts on inside of tube ,hand tighten only bolts with no sikaflex. A/RSikaflex-241/-291 <u>M1124958</u> Expiry date: <u>13/03</u></div> <div>3-Remove "T" pins once sikaflex is dry.</div> <div>4-Coat all exposed hardware with LPS Procyon. Remove any excess off with MEK degreaser. A/RLPS Procyon <u>M1122906</u></div>								

1 x d all 13/05/21

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data <input type="checkbox"/>									
Equip/Tooling <input type="checkbox"/>									
Operator <input type="checkbox"/>									
Material <input type="checkbox"/>									
Setup <input type="checkbox"/>									
Other <input type="checkbox"/>									
Process <input type="checkbox"/>									
Supplier <input type="checkbox"/>									
Training <input type="checkbox"/>									
Unapproved <input type="checkbox"/>									

FAULT CATEGORY

Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other _____ _____ _____ _____
---	---	---

Work Order ID 94460

94460

Page 3

December-19-12 11:14:44 AM

Item ID: D412-742-043 Accept

N900040100 Setup Start *NS1*

Revision ID:

Stop *NS2*

Item Name: Replacement Float Skidtube

Start Date: 1/21/13 Start Qty: 1.00 *1*

Cust Item ID:

Required Date: 1/21/13 Req'd Qty: 1.00 *1*

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start *NR1*

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

120 QC5- Inspect part completeness to step on W/O 0.00

21

120

QC

Memo

0.00

Quality Control

BS 21

130 0.00

130

Packaging

Packaging

Memo

0.00

Packaging

Identify and pack for shipping as per PPP D412-742-043

Location: _____

PPP Rev: _____

PPP 100758

140 QC21- Final Inspection - Work Order Release 0.00

140

QC

Memo

0.00

Quality Control

13/5/22

MP 13-5-22

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____				DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		AGAINST DEPARTMENT/PROCESS <div style="display: flex; justify-content: space-between;"> <div> Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab <input type="checkbox"/> </div> <div> Crosstube <input type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite <input type="checkbox"/> </div> <div> Water Jet <input type="checkbox"/> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier <input type="checkbox"/> </div> <div> Engineering <input type="checkbox"/> Quality <input type="checkbox"/> Other <input type="checkbox"/> </div> </div>					
Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector		
Doc/Data											
Equip/Tooling											
Operator											
Material											
Setup											
Other											
Process											
Supplier											
Training											
Unapproved											

FAULT CATEGORY			
Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions	<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other

Picklist Print

December-19-12 11:14:43 AM

Page 1

Work Order ID: 94460

Parent Item: D412-742-043

Parent Item Name: Replacement Float Skidtube

Start Date: 1/21/13

Required Date: 1/21/13

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP Rev A 05.10.13 New Issue KJ/JLM
 IPP Rev 06.02.13 ECN 773 dwg @ rev.D EC
 IPP Rev:C 07-05-28 As per Rev F JLM
 IPP Rev:D 07-12-04 ECN 1072 DD verified by:JLM
 IPP Rev:E 08-09-08 ecn 08-510 DD verified by:EC
 REV.B DD verified by:EC
 IPP Rev:F 11.11.01 as per DSI9517

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D3391-021 Fwd Tube Assembly	N A wood on 1009A MF 13-5-20	Manufactured	No			110	Each	0.0000	1	1394130 (1x)	11	13/05/21	
D3391-023 Mid Tube Assembly		Manufactured	No			110	Each	0.0000	1	13100919 (1x)	11	13/05/21	
D3391-025 Aft Tube Assembly		Manufactured	No			110	Each	0.0000	1	1392697 (1x)	11	13/05/21	
AN3C4A BOLT		Purchased	No			110	Each	1,844.0000	24	11 24 13/05/21			
<u>Location</u>						<u>Loc Qty</u>	<u>Loc Code</u>						
FG						20							
122814						20							
FP001						172							
123759						172							
ST512						1652							
123759						1652							
AN3C6A BOLT		Purchased	No			110	Each	718.0000	10	11 10 13/05/21			
<u>Location</u>						<u>Loc Qty</u>	<u>Loc Code</u>						
FG						10							
122416						10							
FP001						424							
122599						424							
FP002						1							
111982						1							
ST351						283							
122416						283							

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____				DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		AGAINST DEPARTMENT/PROCESS <div style="display: flex; justify-content: space-between;"> <div> Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab <input type="checkbox"/> </div> <div> Crosstube <input type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite <input type="checkbox"/> </div> <div> Water Jet <input type="checkbox"/> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier <input type="checkbox"/> </div> <div> Engineering <input type="checkbox"/> Quality <input type="checkbox"/> Other <input type="checkbox"/> </div> </div>					
Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector		
Doc/Data <input type="checkbox"/>											
Equip/Tooling <input type="checkbox"/>											
Operator <input type="checkbox"/>											
Material <input type="checkbox"/>											
Setup <input type="checkbox"/>											
Other <input type="checkbox"/>											
Process <input type="checkbox"/>											
Supplier <input type="checkbox"/>											
Training <input type="checkbox"/>											
Unapproved <input type="checkbox"/>											

FAULT CATEGORY			
Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions	<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other

Picklist Print

December-19-12 11:14:43 AM

Page 2

Work Order ID: 94460

Parent Item: D412-742-043

Parent Item Name: Replacement Float Skidtube

AN3C7A Purchased No
BOLT

Location

FG 122141
FP001 122800
ST351 123900

AN960C10L ✕ NAS1149C0332R Purchased No
washer

D4095-041 Manufactured No
Wearplate Assembly

Location

FP002 83809
85844
85939
86094
89032

D4095-043 Manufactured No
Wearplate Assembly

Location

FP002 83479
85615
92345

Start Date: 1/21/13

Required Date: 1/21/13

Start Qty: 1.00

Required Qty: 1.00

110 Each 73.0000

4 4 13/05/12

Loc Qty

Loc Code

10 M124221
10
25
25
38
38

✓

110 Each 0.0000
M123759

38 38 13/05/12

110 Each 22.0000

1 1 13/05/12

Loc Qty

Loc Code

22
7
5
2
6
2

110 Each 12.0000

1 1 13/05/12

Loc Qty

Loc Code

12
7
1
4

December-19-12 11:14:43 AM

Shop Packet Print

Page 2

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data <input type="checkbox"/>									
Equip/Tooling <input type="checkbox"/>									
Operator <input type="checkbox"/>									
Material <input type="checkbox"/>									
Setup <input type="checkbox"/>									
Other <input type="checkbox"/>									
Process <input type="checkbox"/>									
Supplier <input type="checkbox"/>									
Training <input type="checkbox"/>									
Unapproved <input type="checkbox"/>									

FAULT CATEGORY

Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions	<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge	<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
---	---	---	--	---

Picklist Print

December-19-12 11:14:43 AM

Page 3

Work Order ID: 94460

Parent Item: D412-742-043

Parent Item Name: Replacement Float Skidtube

D4095-045 Manufactured No
Wearplate Assembly

Start Date: 1/21/13

Required Date: 1/21/13

Start Qty: 1.00

Required Qty: 1.00

110 Each 23.0000

1 24 1 12/05/12

Location

FP002

77737

84081

92664

93054

Loc Qty

23

1

1

10

11

Loc Code

X1

December-19-12 11:14:43 AM

Shop Packet Print

Page 3

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION <div style="display: flex; justify-content: space-around;"> <div>Rework <input type="checkbox"/></div> <div>Skid-tube <input type="checkbox"/></div> <div>Crosstube <input type="checkbox"/></div> <div>Water Jet <input type="checkbox"/></div> <div>Engineering <input type="checkbox"/></div> </div> <div style="display: flex; justify-content: space-around;"> <div>Scrap <input type="checkbox"/></div> <div>Machining <input type="checkbox"/></div> <div>Small Fab <input type="checkbox"/></div> <div>Prod. Eng. Coord. <input type="checkbox"/></div> <div>Quality <input type="checkbox"/></div> </div> <div style="display: flex; justify-content: space-around;"> <div>Use-as-is <input type="checkbox"/></div> <div>Thermoforming <input type="checkbox"/></div> <div>Finishing <input type="checkbox"/></div> <div>Rec/Store/Packaging <input type="checkbox"/></div> <div>Other <input type="checkbox"/></div> </div> <div style="display: flex; justify-content: space-around;"> <div>Work Order Update <input type="checkbox"/></div> <div>Large Fab <input type="checkbox"/></div> <div>Composite <input type="checkbox"/></div> <div>Supplier <input type="checkbox"/></div> </div>	
--	---	--

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data									
Equip/Tooling									
Operator									
Material									
Setup									
Other									
Process									
Supplier									
Training									
Unapproved									

FAULT CATEGORY

Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions	<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge	<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
---	---	---	--	---

SEAL WITH SIKAFLEX-241/-291 PRIOR TO INSTALLATION OF WEARSHOES

D3391-011 FWD TUBE ASSEMBLY

TRANSFER DRILL THRU D3391-011 OPEN TO ± 0.005 $\pm 0.438-0.000$

D3391-013 MID TUBE ASSEMBLY

MS27039C4-12 SCREW D3672-3 WASHER AN960C416L WASHER 4 PL

SEAL WITH SIKAFLEX-241/-291 PRIOR TO INSTALLATION OF WEARSHOES

D3391-015 AFT TUBE ASSEMBLY

D4095-051 WEARSHOE REF

AN3C4A BOLT (1) AN960C10L WASHER (1) 4 PL

D4095-041 WEARSHOE

D4095-045 WEARSHOE

AN3C4A BOLT (1) AN960C10L WASHER (1) 20 PL

AN3C6A BOLT AN960C10L WASHER 6 PL

AN3C7A BOLT AN960C10L WASHER 4 PL

D4095-043 WEARSHOE

AN3C6A BOLT AN960C10L WASHER 4 PL

D4095-049 WEARPAD REF

D4095-047 WEARPAD REF

Ø0.50 4 PL

Ø0.50 4 PL

SHOT RETURNED TO ENGINEER UNCONTROLLED SUBJECT TO WORK NO. 94460 MJS 12-12-19

RELEASED 2011-11-04 ECN# 11-662

D3391-041 FLOAT SKIDTUBE ASSEMBLY PARTS LIST


QTY	PART NUMBER	DESCRIPTION
X	D3391-041	FLOAT SKIDTUBE ASSEMBLY
1	D3391-011	FWD TUBE ASSEMBLY
1	D3391-013	MID TUBE ASSEMBLY
1	D3391-015	AFT TUBE ASSEMBLY
2	D3591-1	BUSHING
4	D3672-3	WASHER
1	D4095-041	WEARSHOE
1	D4095-043	WEARSHOE
1	D4095-045	WEARSHOE
1	D4095-047	WEARPAD
1	D4095-049	WEARPAD
1	D4095-051	WEARSHOE
24	AN3C4A	BOLT
10	AN3C6A	BOLT
4	AN3C7A	BOLT
38	AN960C10L	WASHER
4	MS27039C4-12	SCREW
4	AN960C416L	WASHER

GENERAL NOTES

- 1) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1 POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- 2) COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY, CLEAN EXCESS OFF POWDER COATING WITH MEK DEGREASER.
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL Ø0.297 SIZE HOLES FOR WEARSHOE INSERTS. CBORE AS NOTED AND INSTALL INSERTS EXCEPT WHERE INDICATED.
- 6) FIT D4095-041 TO SKIDTUBE WITH D2571 AND D2572 SADDLES INSTALLED WITH APPROPRIATE HARDWARE AND SPACERS IN FORWARD AND AFT HOLES AND TRANSFER DRILL Ø0.50 HOLES FROM SADDLE TO D4095-041
- 7) FIT D4095-043 TO SKIDTUBE WITH D2571 AND D2572 SADDLES INSTALLED WITH THE APPROPRIATE HARDWARE AND SPACERS IN FORWARD AND AFT HOLES AND TRANSFER DRILL Ø0.50 HOLES FROM SADDLE TO D4095-043

I	REMOVE GASKETS AND REPLACE ALL WEARSHOES; PARTS LIST UPDATE, ZN A8-1, ZN A8-2, ZN A6-4, ZN B6-8; LPS-3 COATING REMOVED FROM NOTE 2, ZN A3-1, ZN A3-2, REMOVED INSERT AELS-1032-130, ZN B6-4, B2-4, C7-8, C3-8; REMOVED HOLES, ZN D6-4 ZN D2-4, ZN D7-8, ZN D3-8	XDF	11.10.13
H	DRAWING UPDATED TO CURRENT STANDARDS. SHT 1 PL ADDED D3591-1 BUSHING, ZN C6 Ø0.438 DIM WAS 4 PL. ADDED Ø0.499 DIM AND D3591-1 BUSHING. SHT 2 PL ADDED D3591-1 BUSHING, ZN C6 Ø0.438 DIM WAS 4 PL. ADDED Ø0.499 DIM AND D3591-1 BUSHING. (FOR FURTHER INFO SEE DSI 9364 & NCR 08-074)	AJS	08.08.20
G	REPLACE NAS INSERTS W/ AELS INSERTS SWITCH TO D3670-XXXX SPACERS FOR INSTALLING FLOAT BAGS, DWG REORGANIZED FOR CLARITY	DC	07.07.31
F	ADD SS WEARSHOE, GASKET REMOVE FWD SADDLE HOLE -011/-021	PH	07.01.18
E	CHANGE TOLERANCE, EASE MANUFACTURE	PH	06.04.25
D	UPDATE TOLERANCE, CHANGE HOLE SIZE	PH	06.01.23
C	LENGTHEN AFT EXTENSION	PH	05.09.27
B	DRAWING UPDATES	PH	05.06.10
A	NEW ISSUE	PH	05.02.07
REV.	DESCRIPTION	BY	DATE
DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	XDF	KENT, WA	
CHECKED		DRAWING NO.	REV. 1
MFG. APPR.		D3391	SHEET 1 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	11.10.13	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL. AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

94460

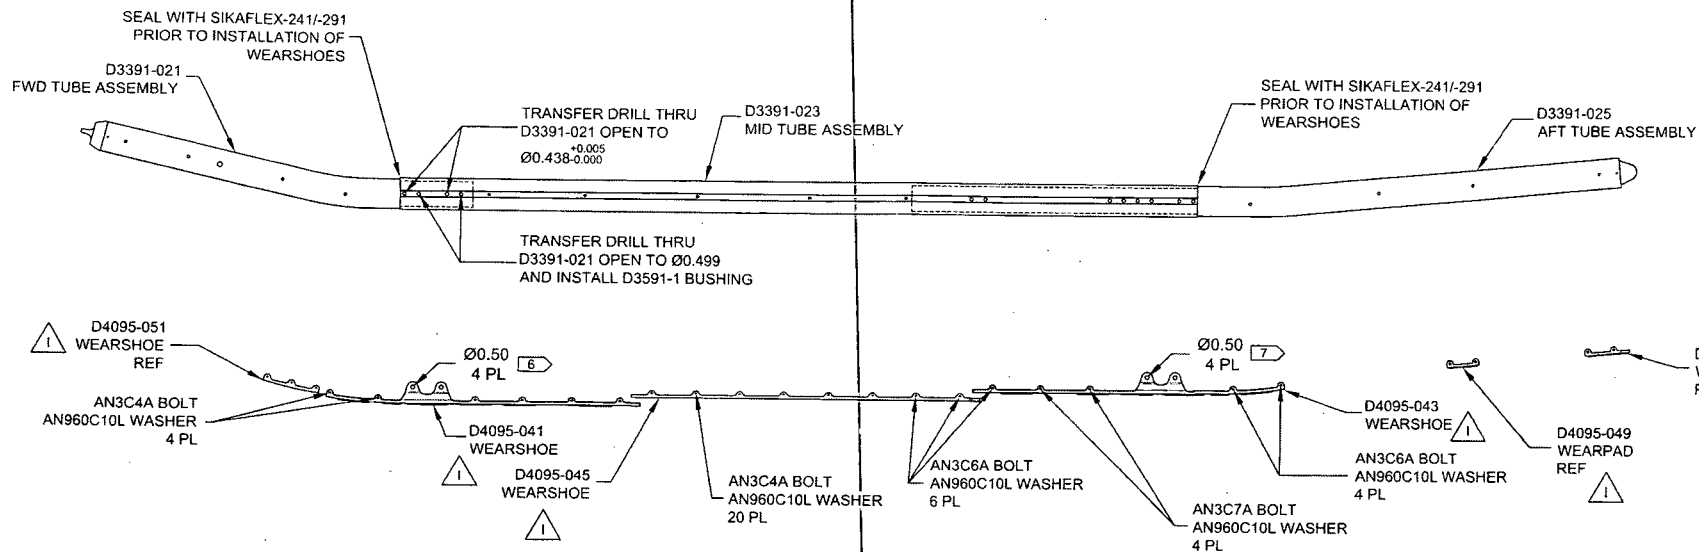

D3391-043 ASSEMBLY

D3391-043 FLOAT SKIDTUBE ASSEMBLY PARTS LIST

QTY -043	PART NUMBER	DESCRIPTION
X	D3391-043	FLOAT SKIDTUBE ASSEMBLY
1	D3391-021	FWD TUBE ASSEMBLY
1	D3391-023	MID TUBE ASSEMBLY
1	D3391-025	AFT TUBE ASSEMBLY
2	D3591-1	BUSHING
1	D4095-041	WEARSHOE
1	D4095-043	WEARSHOE
1	D4095-045	WEARSHOE
1	D4095-047	WEARPAD
1	D4095-049	WEARPAD
1	D4095-051	WEARSHOE
24	AN3C4A	BOLT
10	AN3C6A	BOLT
4	AN3C7A	BOLT
38	AN960C10L	WASHER


GENERAL NOTES

- 1) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
POWDER COAT WHITE (4:3.5.1) PER DART QSI 005 4.3
- 2) COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON"
AFTER FINAL ASSEMBLY. CLEAN EXCESS OFF POWDER COATING WITH MEK DEGREASER.
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL Ø0.297 SIZE HOLES
FOR WEARSHOE INSERTS. C'BORE AS NOTED AND INSTALL INSERTS EXCEPT
WHERE INDICATED.
- 6) FIT D4095-041 TO SKIDTUBE WITH D2571 AND D2572 SADDLES INSTALLED WITH
APPROPRIATE HARDWARE AND SPACERS IN FORWARD AND AFT HOLES AND
TRANSFER DRILL Ø0.50 HOLES FROM SADDLE TO D4095-041
- 7) FIT D4095-043 TO SKIDTUBE WITH D2571 AND D2572 SADDLES INSTALLED WITH
THE APPROPRIATE HARDWARE AND SPACERS IN FORWARD AND AFT HOLES AND
TRANSFER DRILL Ø0.50 HOLES FROM SADDLE TO D4095-043


RELEASED
2011-11-04

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	XDF	KENT, WA	
CHECKED		DRAWING NO.	REV. 1
MFG. APPR.		D3391	SHEET 2 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	11.10.13	<small>COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL. AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	


94460

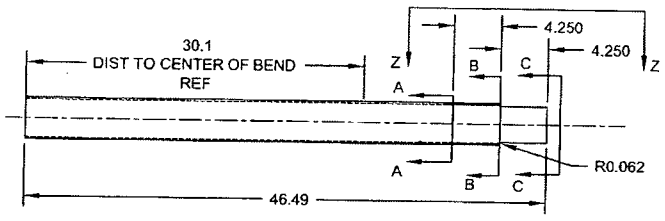


D3391-1 CUTTING DETAIL
(MAKE FROM D6013-047 SKIDTUBE MATERIAL)

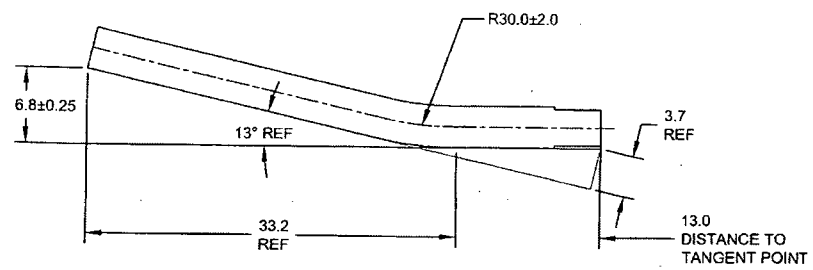


D3391-011/-021 BENDING DETAIL
(MAKE FROM D3391-1)

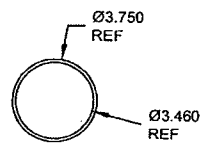


SECTION A-A
SCALE 2X

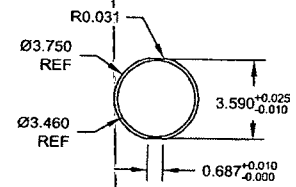

SECTION B-B
SCALE 2X

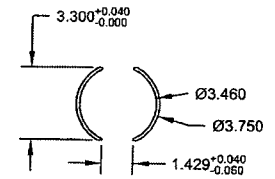

SECTION C-C
SCALE 2X




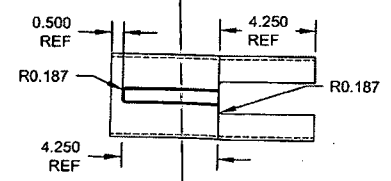


VIEW Z-Z
SCALE 2X

RELEASED
2011-11-04

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	XDF	KENT, WA	
CHECKED		DRAWING NO.	REV. 1
MFG. APPR.		D3391	SHEET 3 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	11.10.13	<small>COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE DISCLOSED FOR ANY PURPOSE OR COMMERCE TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	


94460

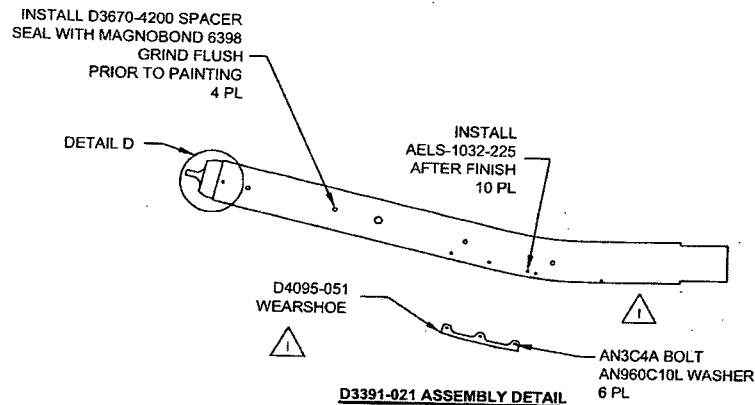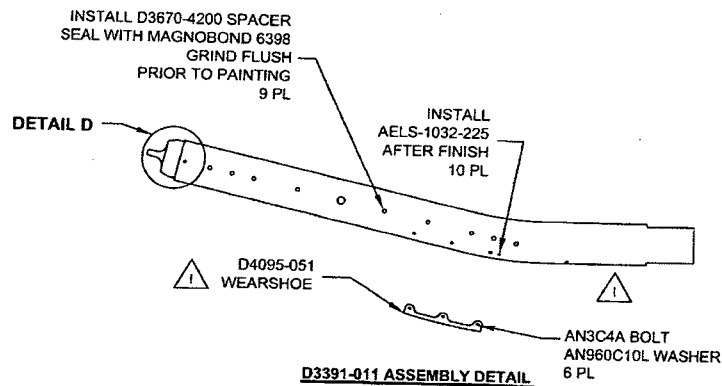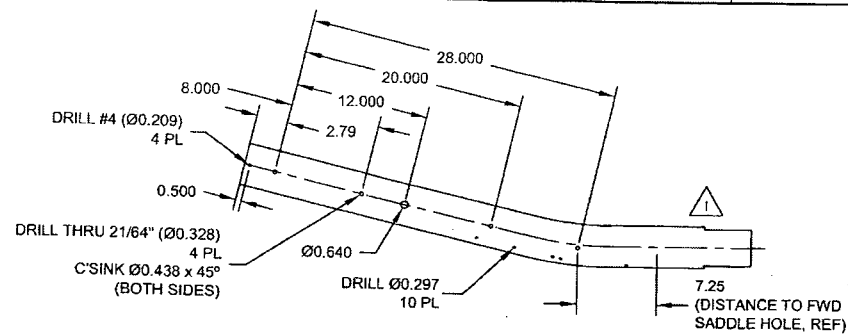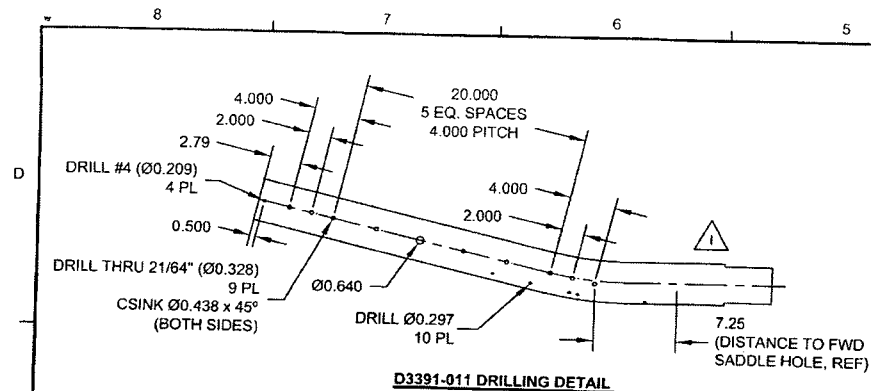

D3391-011/-021 FWD TUBE ASSEMBLY PARTS LIST

QTY - 011	QTY - 021	PART NUMBER	DESCRIPTION
X		D3391-011	FWD TUBE ASSEMBLY
	X	D3391-021	FWD TUBE ASSEMBLY
1	1	D3401-041	TOW CAP
9	4	D3670-4200	SPACER
4	4	D3672-1	WASHER
1	1	D4095-051	WEARSHOE
1	1	D6013-047	FWD TUBE
10	10	AN3C4A	BOLT
10	10	AN960C10L	WASHER
10	10	AELS-1032-225	INSERT


SEAL WITH SIKAFLEX-241/-291

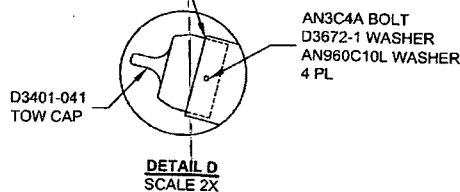


RELEASED
2011-11-04

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	XDF	KENT, WA	
CHECKED		DRAWING NO.	REV. 1
MFG. APPR.		D3391	SHEET 4 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	11.10.13	<small>COPYRIGHT © 2006 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE REPRODUCED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	


94460

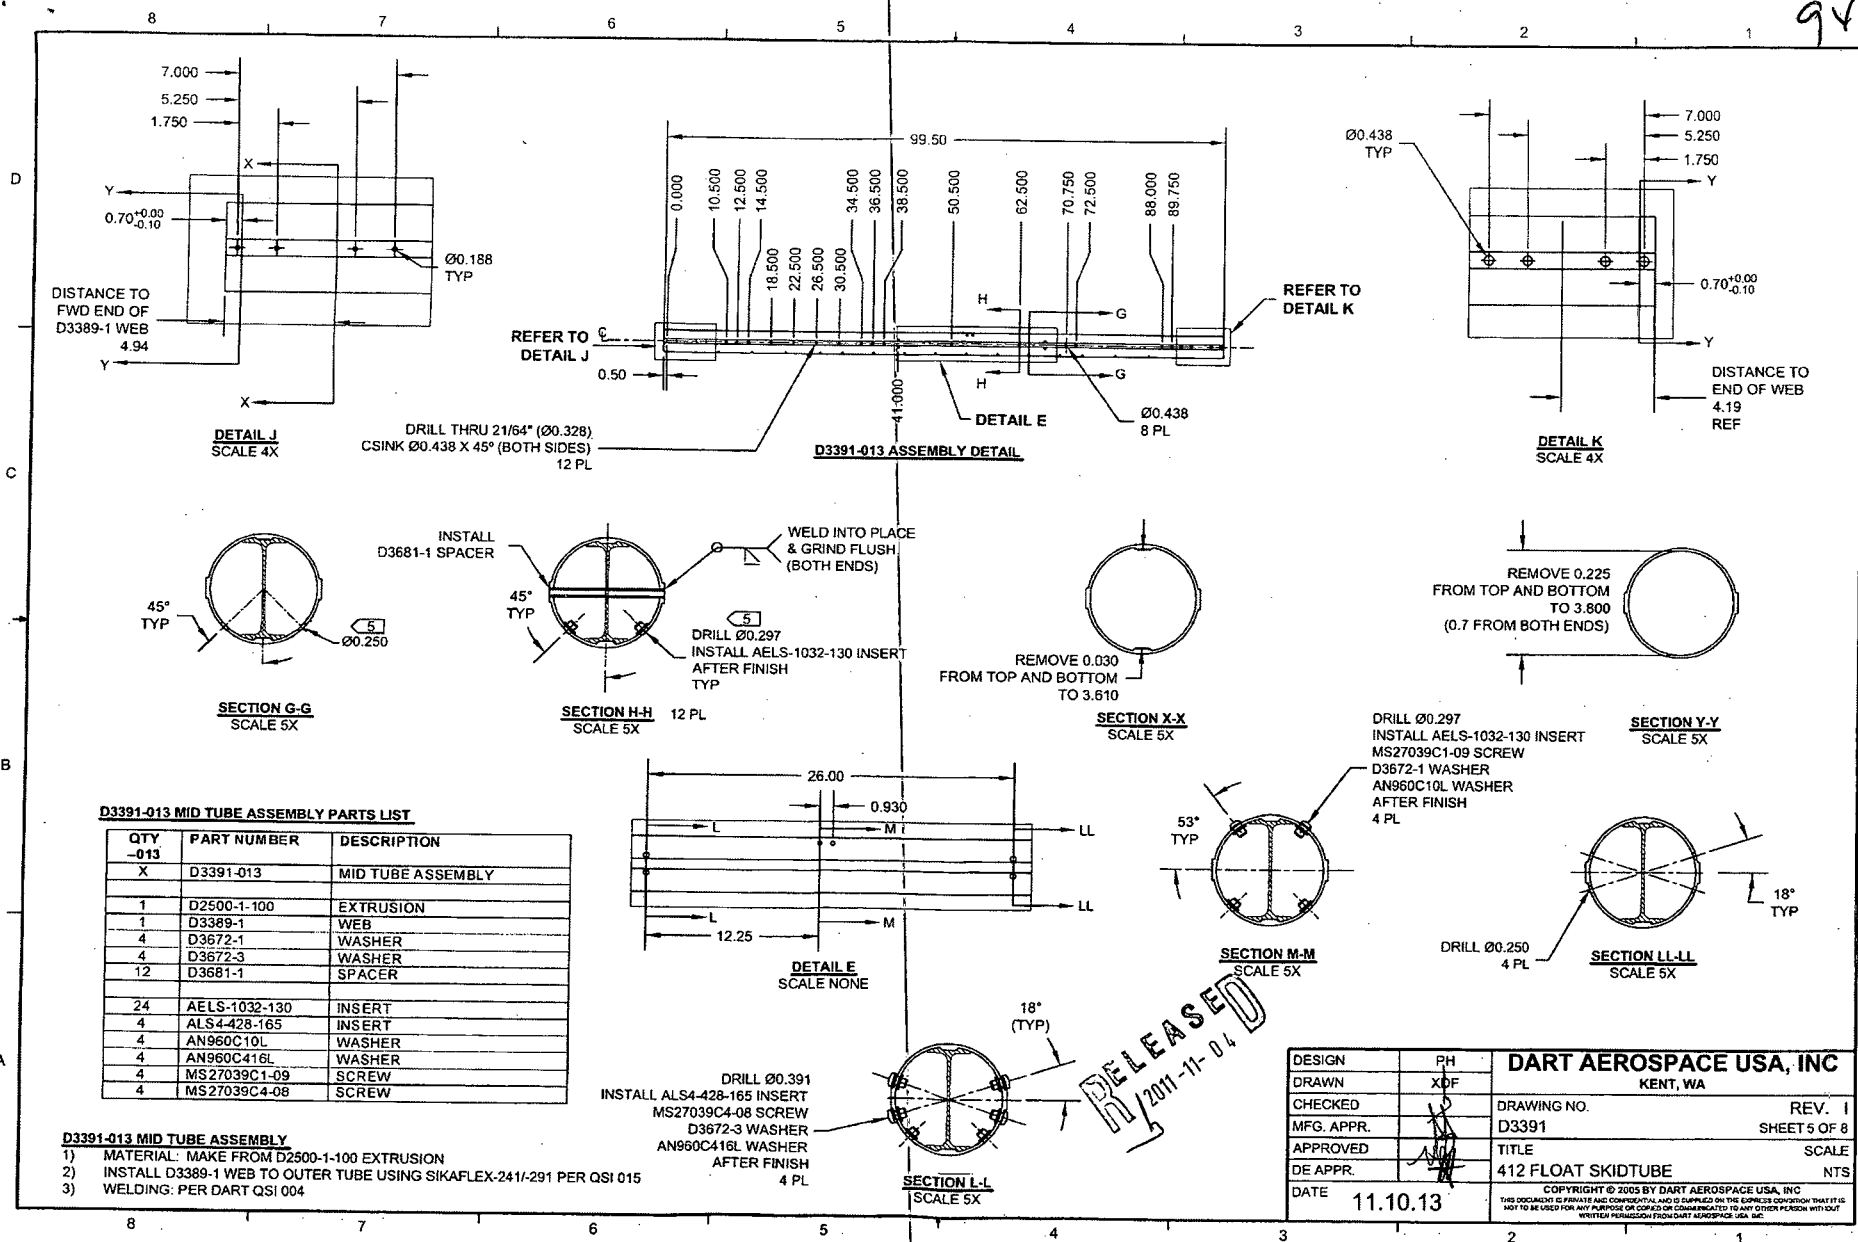


94460

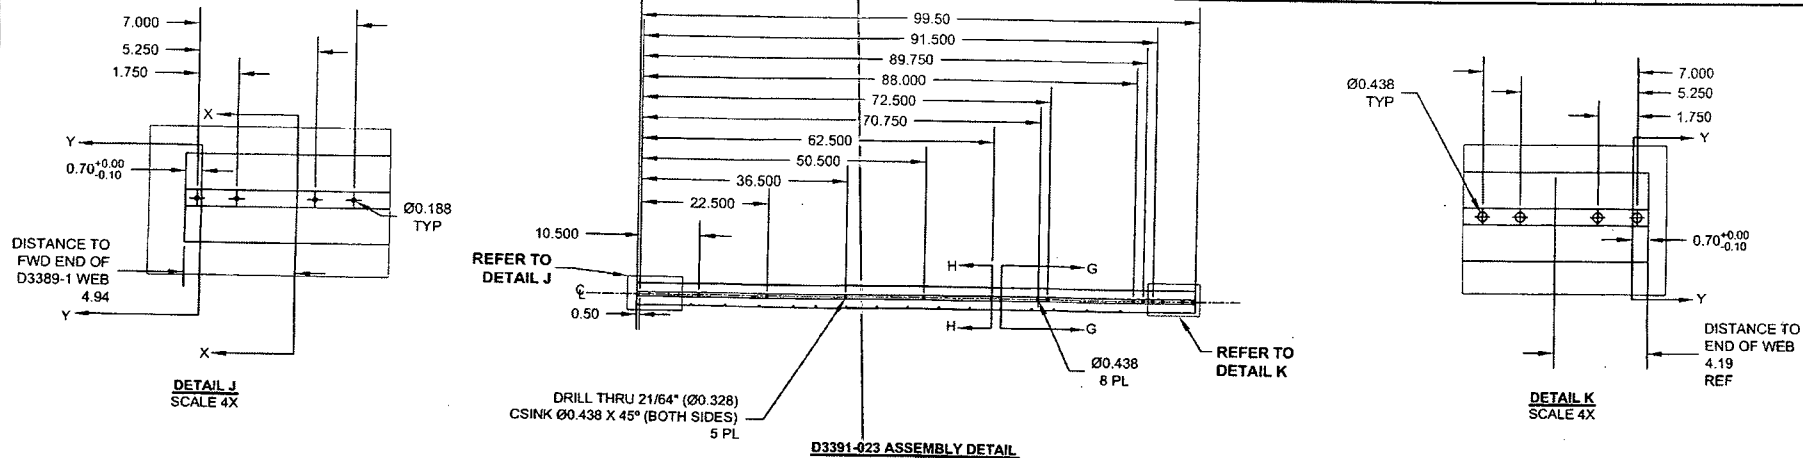


SECTION G-G
SCALE 5X

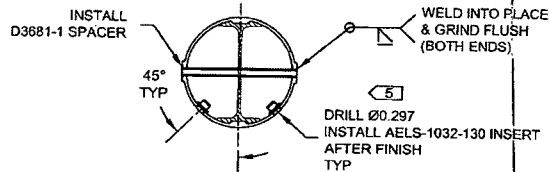

SECTION H-H
SCALE 5X

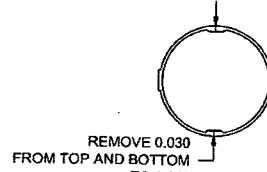

SECTION X-X
SCALE 5X

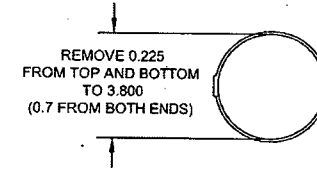

SECTION Y-Y
SCALE 5X

D3391-023 MID TUBE ASSEMBLY PARTS LIST

QTY - 023	PART NUMBER	DESCRIPTION
X	D3391-023	MID TUBE ASSEMBLY
1	D2500-1-100	EXTRUSION
1	D3389-1	WEB
5	D3681-1	SPACER
20	AELS-1032-130	INSERT

D3391-023 MID TUBE ASSEMBLY


- 1) MATERIAL: MAKE FROM D2500-1-100 EXTRUSION
- 2) INSTALL D3389-1 WEB TO OUTER TUBE USING SIKAFLEX-241/291 PER QSI 015
- 3) WELDING: PER DART QSI 004

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	XDF	KENT, WA	
CHECKED		DRAWING NO.	REV. 1
MFG. APPR.		D3391	SHEET 6 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	11.10.13	COPYRIGHT © 2006 BY DART AEROSPACE USA, INC	


THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE LOANED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

RELEASED
2011-11-04


94460

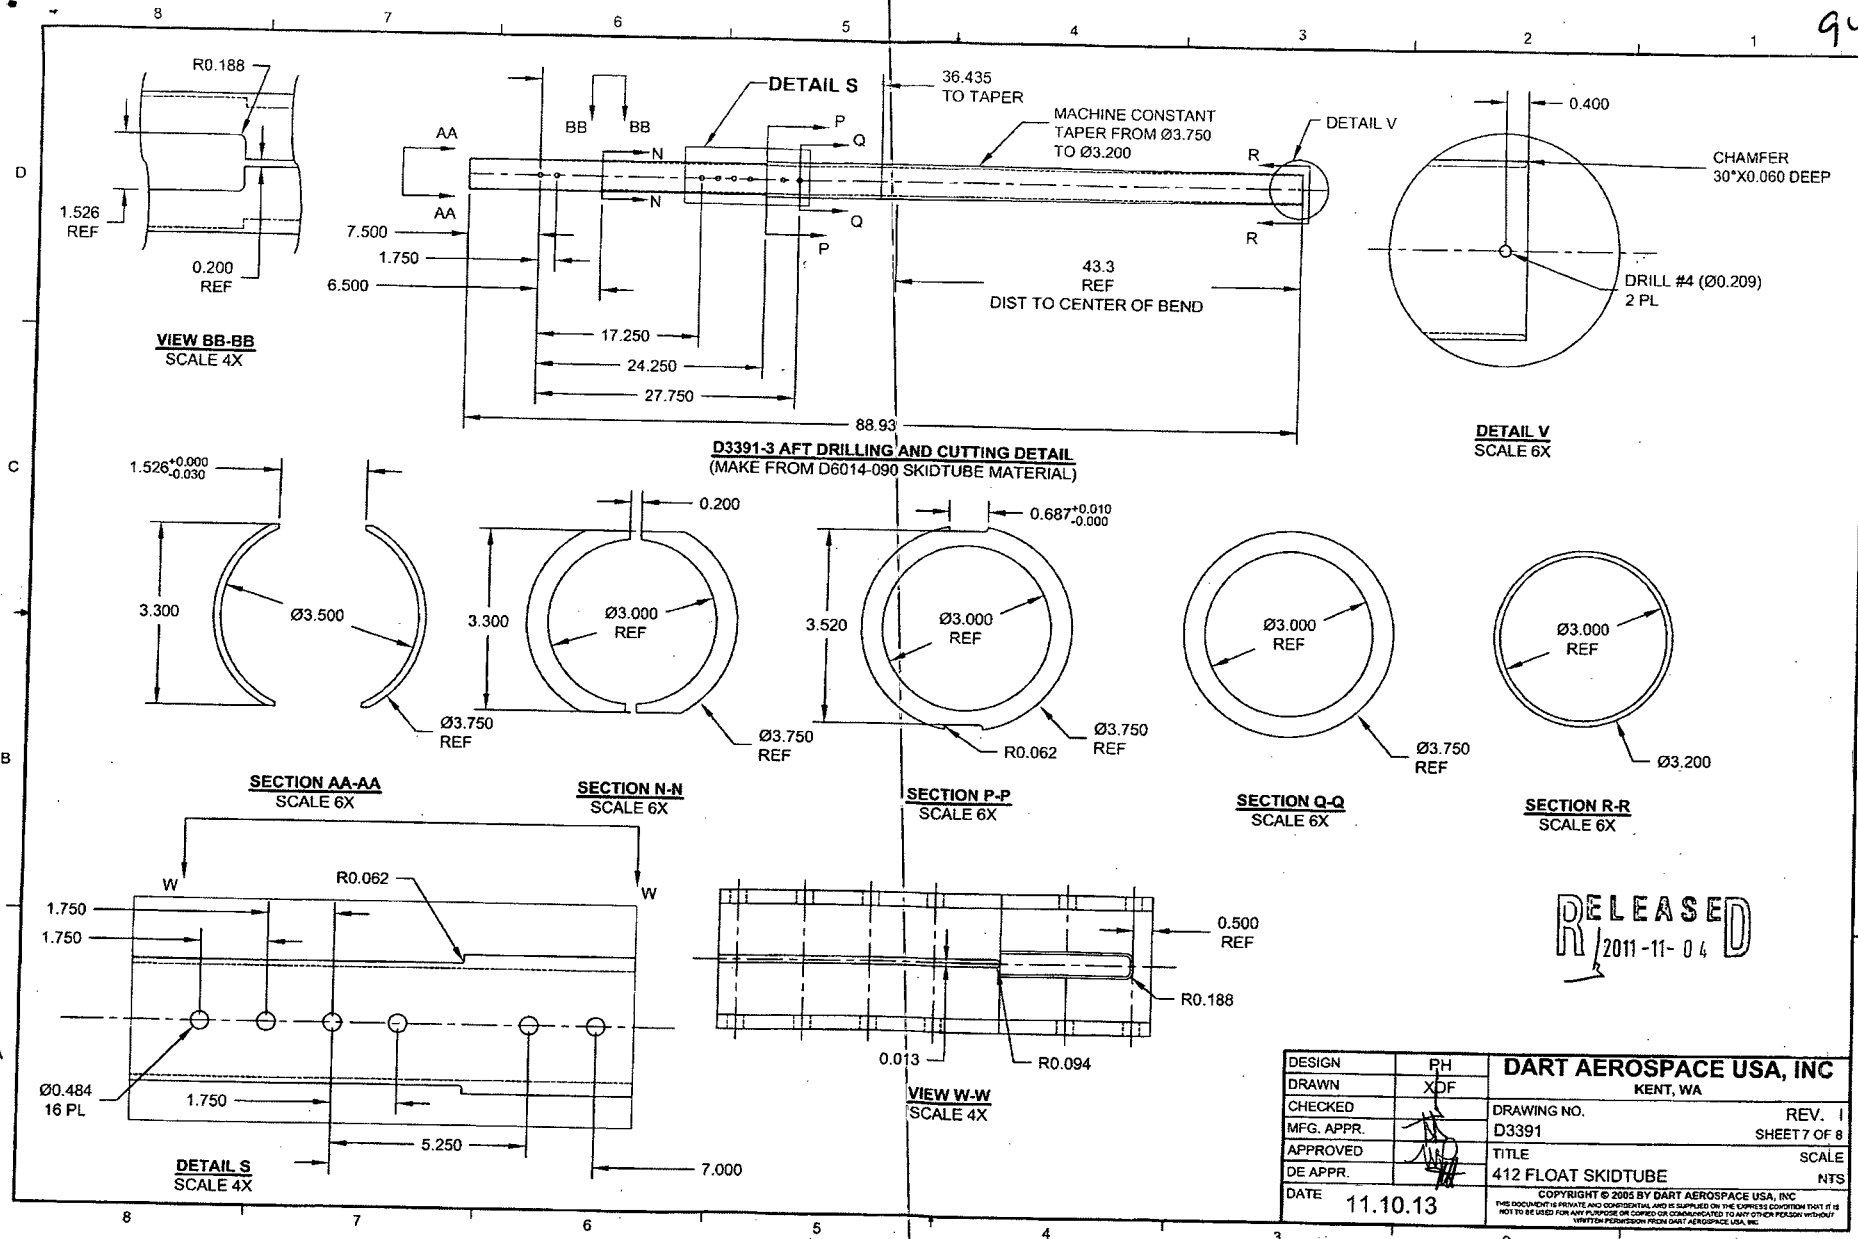

94460

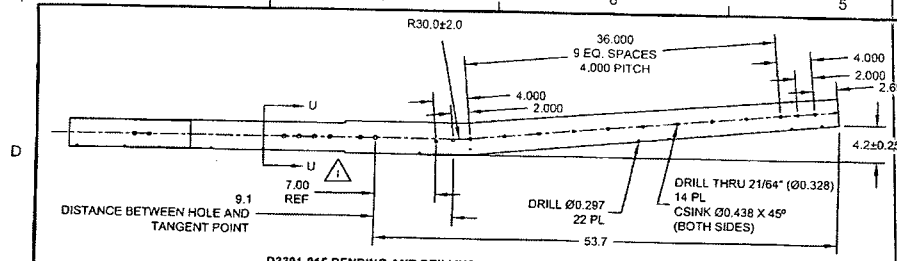

D3391-015 BENDING AND DRILLING DETAIL
(SEE CBORE DETAIL BELOW)

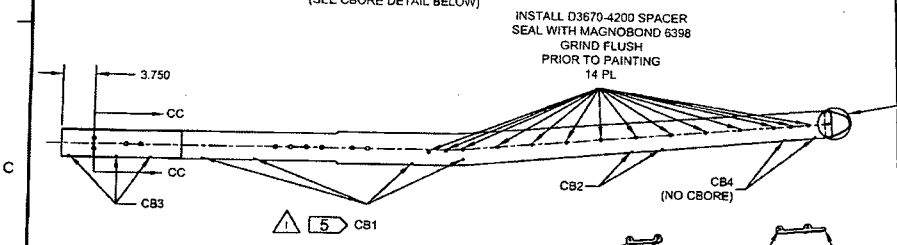



D3391-015 ASSEMBLY AND CBORE DETAIL
(SEE TABLE)

D3391-015/-025 AFT TUBE ASSEMBLY PARTS LIST


QTY - 015	QTY - 025	PART NUMBER	DESCRIPTION
X	X	D3391-015	AFT TUBE ASSEMBLY
		D3391-025	AFT TUBE ASSEMBLY
1	1	D2646	AFT CAP
14	4	D3670-4200	SPACER
2	2	D3672-1	WASHER
1	1	D4095-049	WEARPAD
1	1	D4095-047	WEARPAD
1	1	D6014-090	AFT TUBE
14	14	AELS-1032-130	INSERT
8	8	AELS-1032-225	INSERT
4	4	ALS4-428-165	INSERT
6	6	AN3C4A	BOLT
4	4	AN3C5A	BOLT
10	10	AN960C10L	WASHER

CBORE HOLES MARKED CB1-CB4 AS FOLLOWS AND
INSTALL AELS-1032-XXX AFTER FINISH AS NOTED

HOLES MARKED	QTY D3391-015	QTY D3391-025	CBORE	P/N
CB1	8	8	Ø0.430 X 0.170	AELS-1032-225
CB2	4	4	Ø0.430 X 0.170	AELS-1032-130
CB3	6	6	Ø0.430 X 0.040	AELS-1032-130
CB4	4	4	NONE	AELS-1032-130

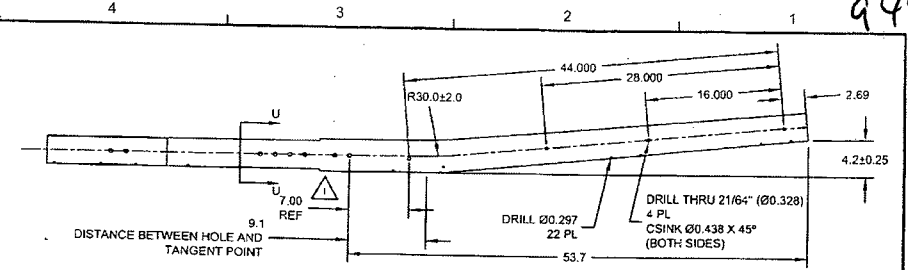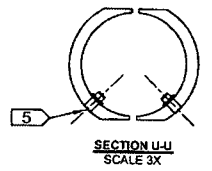


D3391-025 BENDING AND DRILLING DETAIL
(SEE CBORE DETAIL BELOW)

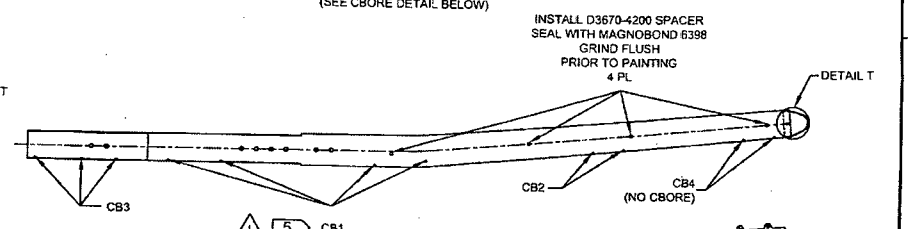


D3391-025 ASSEMBLY AND CBORE DETAIL
(SEE TABLE)

RELEASED
2011-11-04

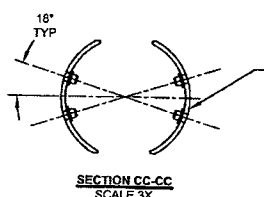

DRILL Ø0.391
CBORE Ø0.516 X 0.040 DEEP
INSTALL ALS4-428-165 INSERT
4 PL

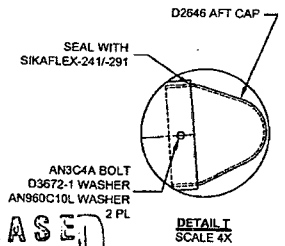

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	XDF	KENT, WA	
CHECKED		DRAWING NO. D3391	REV. 1
MFG. APPR.		SHEET 8 OF 8	
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	11.10.13	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS ORIENTATION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.			